



# AUSTRALIAN NOTICES TO MARINERS

## Notices 39 - 83

Published fortnightly by the Australian Hydrographic Office

Australian Notices to Mariners are the authority for correcting charts and publications published by the Australian Hydrographic Office covering Australia, Papua New Guinea, Solomon Islands, Australian Antarctic Territory and Timor-Leste.

Commodore D.G. MULLINS, RAN  
*Hydrographer of Australia*

---

### SECTIONS.

- I. Australian Notices to Mariners, including blocks and notes.
- II. Hydrographic Reports.

### SUPPLEMENTS.

- I. Tracings
- II. Cumulative List of Australian Notices to Mariners.
- III. Cumulative List of Temporary and Preliminary Australian Notices to Mariners.
- IV. Temporary and Preliminary Notices in force.

---

---

© Commonwealth of Australia 2026

This work is copyright. Apart from any use permitted under the Copyright Act 1968, no part may be reproduced by any process, adapted, communicated or commercially exploited without prior written permission from The Commonwealth represented by the Australian Hydrographic Office.

## **IMPORTANT NOTICE**

This edition of Notices to Mariners includes all navigationally significant information affecting AHO products which the AHO has become aware of since the last edition. All reasonable efforts have been made to ensure the accuracy and completeness of the information, including third party information, on which these updates are based. The AHO regards third parties from which it receives information as reliable, however the AHO cannot verify all such information and errors may therefore exist. The AHO does not accept liability for errors in third party information.

---

## **GENERAL INSTRUCTIONS**

The substance of these notices should be inserted on the charts affected.

Bearings are referred to the true compass and are reckoned clockwise from North; those relating to lights are given as seen by an observer from seaward.

Positions quoted in notices relate to WGS84 which is the horizontal datum for all charts produced by the Australian Hydrographic Office.

The range quoted for a light is its nominal range.

Depths are with reference to the chart datum of each chart. Heights are above mean high water springs or mean higher high water, as appropriate.

The capital letter (P) or (T) after the number of any notice denotes a preliminary or temporary notice respectively, which are contained separately at the end of the permanent notices.

---

## **REPORTING OF DANGERS**

Mariners are particularly requested to notify the AUSTRALIAN HYDROGRAPHIC OFFICE, Locked Bag 8801 Wollongong, NSW 2500 (e-mail [datacentre@hydro.gov.au](mailto:datacentre@hydro.gov.au) or, alternatively by filling in and submitting the **Hydrographic Notes** forms located on the web site – [www.hydro.gov.au](http://www.hydro.gov.au)), immediately on the discovery of new dangers or suspected dangers to navigation. For changes or defects in aids to navigation notify AusSAR (Fax 02-6230 6868 or email [rccaus@amsa.gov.au](mailto:rccaus@amsa.gov.au)).

---

## **AUTHORISED USE**

Copies of Australian notices are available free of charge from the Australian Hydrographic Office (AHO) website ([www.hydro.gov.au](http://www.hydro.gov.au)) and through the eNotices (email) service ([www.hydro.gov.au/enotices/enotices.htm](http://www.hydro.gov.au/enotices/enotices.htm)).

Individual Notices may be copied for the purpose of inserting Notice substance on official charts and publications. Paper copies may be printed by chart agents and distributed to customers on a cost recovery basis. Participating chart agents are listed on the AHO website as providing a 'Paper Notices to Mariners' service ([www.hydro.gov.au/prodserv/agents-list.htm](http://www.hydro.gov.au/prodserv/agents-list.htm)). Copies of the notices may not be sold for profit without prior written agreement.

## NUMERICAL INDEX OF NOTICES TO MARINERS

### Edition No 2

Notices	Aus Chart, INT Chart, ENC Cell, AHP, BA Pubs
39	Aus 143, 144
40	Aus 195, 198, 615
41	Aus 825
42	Aus 817
43	PNG 379
44	Aus 293, 294, 299, 839, 841
45	Aus 4603, INT 603
46	Aus 327, 328
47	Aus 754, 755
48	Aus 130, 781
49	Aus 349
50	Aus 155
51	Aus 157
52(T)	Aus 490, 816, 818
53(T)	Aus 236
54(T)	Aus 236, 237
55(T)	Aus 817, 818
56(T)	Aus 236, 815
57(T)	Aus 256, 827
58(T)	Aus 246
59(T)	Aus 817
60(T)	Aus 236, 237
61(T)	Aus 248, 249, 250, 251, 252, 253, 254, 256, 259, 260, 265, 367, 490, 819, 820, 821, 822, 823, 824, 825, 826, 827, 828, 829, 830
62(T)	Aus 309
63(T)	Aus 130, 143, 198, 335, 336, 343, 346, 348, 349, 357, 485, 487, 489, 754, 780, 781, 801, 802, 808, 4601, 4602, 4708, 4709, 4710, INT 601, 602, 708, 709, 710
64(T)	Aus 130, 143, 198, 335, 336, 343, 346, 348, 349, 357, 485, 487, 489, 754, 780, 781, 801, 802, 808, 4601, 4602, 4708, 4709, 4710, INT 601, 602, 708, 709, 710
65(T)	Aus 64
66(T)	Aus 120, 341
67(T)	Aus 346, 485
68(T)	Aus 343, 346, 780
69(T)	Aus 777, 778
70(T)	Aus 357
71(T)	Aus 349
72(T)	Aus 143, 157
73(T)	Aus 144
74(T)	Aus 143, 155
75(T)	Aus 155
76(T)	Aus 155
77(T)	Aus 155
78(T)	Aus 143
79(T)	Aus 151
80(T)	Aus 171, 173, 795, 796
81(T)	Aus 173, 795
82(T)	Aus 4060, 4604, INT 60, 604, SLB 302, 1001, 1002
83(T)	SLB 102, 301, 302

## NUMERICAL INDEX OF CHARTS AFFECTED

### Edition No 2

Aus Chart	Notices	Aus Chart	Notices
Aus 64	65(T)	Aus 801	63(T), 64(T)
Aus 120	66(T)	Aus 802	63(T), 64(T)
Aus 130	48, 63(T), 64(T)	Aus 808	63(T), 64(T)
Aus 143	39, 63(T), 64(T), 72(T), 74(T), 78(T)	Aus 815	56(T)
Aus 144	39, 73(T)	Aus 816	52(T)
Aus 151	79(T)	Aus 817	42, 55(T), 59(T)
Aus 155	50, 74(T), 75(T), 76(T), 77(T)	Aus 818	52(T), 55(T)
Aus 157	51, 72(T)	Aus 819	61(T)
Aus 171	80(T)	Aus 820	61(T)
Aus 173	80(T), 81(T)	Aus 821	61(T)
Aus 195	40	Aus 822	61(T)
Aus 198	40, 63(T), 64(T)	Aus 823	61(T)
Aus 236	53(T), 54(T), 56(T), 60(T)	Aus 824	61(T)
Aus 237	54(T), 60(T)	Aus 825	41, 61(T)
Aus 246	58(T)	Aus 826	61(T)
Aus 248	61(T)	Aus 827	57(T), 61(T)
Aus 249	61(T)	Aus 828	61(T)
Aus 250	61(T)	Aus 829	61(T)
Aus 251	61(T)	Aus 830	61(T)
Aus 252	61(T)	Aus 839	44
Aus 253	61(T)	Aus 841	44
Aus 254	61(T)	Aus 4060	82(T)
Aus 256	57(T), 61(T)	Aus 4601	63(T), 64(T)
Aus 259	61(T)	Aus 4602	63(T), 64(T)
Aus 260	61(T)	Aus 4603	45
Aus 265	61(T)	Aus 4604	82(T)
Aus 293	44	Aus 4708	63(T), 64(T)
Aus 294	44	Aus 4709	63(T), 64(T)
Aus 299	44	Aus 4710	63(T), 64(T)
Aus 309	62(T)	PNG 379	43
Aus 327	46	SLB 102	83(T)
Aus 328	46	SLB 301	83(T)
Aus 335	63(T), 64(T)	SLB 302	82(T), 83(T)
Aus 336	63(T), 64(T)	SLB 1001	82(T)
Aus 341	66(T)	SLB 1002	82(T)
Aus 343	63(T), 64(T), 68(T)		
Aus 346	63(T), 64(T), 67(T), 68(T)		
Aus 348	63(T), 64(T)		
Aus 349	49, 63(T), 64(T), 71(T)		
Aus 357	63(T), 64(T), 70(T)		
Aus 367	61(T)	INT Chart	Notices
Aus 485	63(T), 64(T), 67(T)	INT 60	82(T)
Aus 487	63(T), 64(T)	INT 601	63(T), 64(T)
Aus 489	63(T), 64(T)	INT 602	63(T), 64(T)
Aus 490	52(T), 61(T)	INT 603	45
Aus 615	40	INT 604	82(T)
Aus 754	47, 63(T), 64(T)	INT 708	63(T), 64(T)
Aus 755	47	INT 709	63(T), 64(T)
Aus 777	69(T)	INT 710	63(T), 64(T)
Aus 778	69(T)		
Aus 780	63(T), 64(T), 68(T)		
Aus 781	48, 63(T), 64(T)		
Aus 795	80(T), 81(T)		
Aus 796	80(T)		

**39 AUSTRALIA - Products - New Charts, New Editions, Withdrawn Charts**  
Australian Hydrographic Office

**New Charts**

<i>Chart</i>	<i>Title and Geographical limits</i>	<i>Scale</i>	<i>Publication Date</i>	<i>Remarks</i>
NIL				

**New Electronic Navigation Chart (Aus ENC)**

<i>Cell Name</i>	<i>Title</i>	<i>Publication Date</i>	<i>Remarks</i>
NIL			

**New Editions and Withdrawn Charts**

<i>Chart</i>	<i>Title</i>	<i>Scale</i>	<i>Publication Date</i>	<i>Remarks</i>
Aus 143	Australia - South Coast - Victoria - Port <b>(Edition 8)</b> Phillip	1:100 000	23/1/2026	New edition with general updating throughout; including latest bathymetric data. <b>Chart Aus 143 Edition 7 dated 28 May 2021 is now superceded and must be withdrawn from use.</b>
Aus 144	Australia - South Coast - Victoria - The Rip <b>(Edition 3)</b>	1:12 500	23/1/2026	New edition with general updating throughout; including latest bathymetric data. <b>Chart Aus 144 Edition 2 dated 20 June 2014 is now superceded and must be withdrawn from use.</b>

**Chart permanently withdrawn**

Charts listed above as withdrawn no longer meet chart carriage requirements and should be marked as "superseded" and replaced with the new chart/ new edition listed prior to passage through the area covered by the new chart.

When placing orders with a chart agent between notice of forthcoming edition and its publication, mariners should advise whether their order pertains to the current edition or the new edition.

For further details refer to the AHO website at [www.hydro.gov.au](http://www.hydro.gov.au) for new edition and new chart stock arrival information.

**40 AUSTRALIA - Products - New Charts and New Editions to be published shortly**  
 Australian Hydrographic Office

**New Charts to be published shortly**

Chart	Title	Scale	Remarks
NIL			

**New Editions to be published shortly**

Chart	Title	Scale	Remarks
Aus 195	Australia - East Coast - New South Wales - Approaches to Port Kembla	1:25 000	New edition with general updating throughout; including latest bathymetric data.
Aus 198	Australia - East Coast - New South Wales - Botany Bay and Port Hacking	1:25 000	New edition with general updating throughout; including latest bathymetric data.
Aus 615	Australia - East Coast - Plans in the Coral Sea (Sheet 3) Plans: Flinders Reefs Flora Reef and Holmes Reefs	1:150 000 1:100 000	New edition with general updating throughout; including latest bathymetric data.

**41 AUSTRALIA - QUEENSLAND - Bait Reef - Light beacon**  
 UKHO

<b>Aus 825</b> [1062/2025]			
Insert	starboard lateral light beacon, <i>Fl.G.2·5s</i> , with topmark	19° 48'.56 S	149° 03'.78 E

**42 AUSTRALIA - QUEENSLAND - Hervey Bay - Artificial reef**  
*Former Notice - 1033(T)/2025 is cancelled*  
 Department of Environment, Tourism, Science and Innovation (DETSI)

<b>Aus 817</b> [1063/2025]			
Insert	fish haven with minimum depth, <i>6<sub>3</sub>m</i> , centred on fish haven with minimum depth, <i>4<sub>4</sub>m</i> , centred on	25° 00'.57 S 25° 14'.04 S	152° 34'.01 E 152° 49'.84 E

**43 PAPUA NEW GUINEA - Caution Bay - Papa - Light**  
 UKHO

<b>PNG 379</b> [538/2025]			
Amend	light to <i>Iso.4s</i>	9° 18'.6 S	146° 59'.5 E

**44 AUSTRALIA - TORRES STRAIT - Prince of Wales Island - Boigu Island - Navaids**  
 Maritime Safety Queensland

**Aus 293 [1018/2025]**

Insert	north cardinal topmark	10° 35'.933 S	142° 12'.514 E
	west cardinal topmark	10° 36'.546 S	142° 12'.767 E

**Aus 294 [NE 25/10/2024]**

Insert	west cardinal topmark	10° 36'.55 S	142° 12'.77 E
--------	-----------------------	--------------	---------------

**Aus 299 [1018/2025]**

Insert	north cardinal topmark	10° 35'.933 S	142° 12'.514 E
	west cardinal topmark	10° 36'.546 S	142° 12'.767 E

**Aus 839 [590/2025]**

Insert	port lateral light beacon, <i>Fl.R.4s</i> , with topmark	10° 11'.67 S	142° 20'.62 E
--------	--	--------------	---------------

**Aus 841 [590/2025]**

Insert	port lateral light beacon, <i>Fl.R.4s</i> , with topmark	10° 11'.67 S	142° 20'.62 E
--------	--	--------------	---------------

Replace	beacon with starboard lateral conical light buoy, <i>Fl.G.2·5s</i> , without topmark	9° 13'.5 S	142° 13'.3 E
---------	--	------------	--------------

**45 AUSTRALIA - ARAFURA SEA - Cape Don - Depth northwards**  
 UKHO

**Aus 4603 (INT 603) [7/2026]**

Insert	depth, 85m	9° 35'.0 S	131° 53'.2 E
--------	------------	------------	--------------

**46 AUSTRALIA - WESTERN AUSTRALIA - Barrow Island - Depths**  
 Australian Hydrographic Office

**Aus 327 [11/2026]**

Insert	accompanying block	20° 53'.8 S	115° 35'.7 E
	accompanying ZOC diagram	21° 10'.2 S	116° 37'.2 E

**Aus 328 [597/2025]**

Insert	accompanying block	20° 57'.0 S	115° 22'.6 E
	accompanying ZOC diagram	21° 47'.6 S	115° 24'.5 E

**47 AUSTRALIA - WESTERN AUSTRALIA - Point Louise to Mandurah - Fish aggregating devices westwards**

Department of Primary Industries and Regional Development WA

**Aus 754 [14/2026]**

Insert	special conical light buoy, <i>Fl.Y.5s FAD (Oct-Apr)</i> , without topmark	32° 03'.01 S	115° 20'.03 E
--------	--	--------------	---------------

Delete	out of position buoy	32° 02'.9 S	115° 20'.0 E
--------	----------------------	-------------	--------------

**Aus 755 [14/2026]**

Insert	special conical light buoy, <i>Fl.Y.5s FAD (Oct-Apr)</i> , without topmark	32° 14'.88 S	115° 07'.30 E
--------	--	--------------	---------------

**48 AUSTRALIA - SOUTH AUSTRALIA - Port Adelaide - Light buoy northwestwards**

Department for Infrastructure and Transport SA Notice 078(T)/2025

**Aus 130 [1073/2025]**

Insert	special pillar light buoy, <i>Fl.Y.3s</i> , with topmark	34° 43'.716 S	138° 18'.852 E
--------	--	---------------	----------------

Delete	depth, 14 <sub>9</sub> m	34° 43'.72 S	138° 18'.84 E
--------	--------------------------	--------------	---------------

**Aus 781 [1070/2025]**

Insert	special pillar light buoy, <i>Fl.Y.3s</i> , with topmark	34° 43'.72 S	138° 18'.85 E
--------	--	--------------	---------------

49 AUSTRALIA - VICTORIA - Port Campbell - Petroleum safety zone southwards  
NOPSEMA

**Aus 349 [984/2025]**  
Insert restricted area with radius 0.27M, centred on 39° 00'.23 S 142° 41'.95 E

50 AUSTRALIA - VICTORIA - Port Phillip - Altona Bay - Coastline  
Australian Hydrographic Office

**Aus 155 [17/2026]**  
Insert accompanying block 37° 52'.8 S 144° 48'.6 E

51 AUSTRALIA - VICTORIA - Port Phillip - Kirk Point - Light sector  
*Former Notice - 1087(T)/2025 is cancelled*  
Parks Victoria NTM 643/2025

**Aus 157 [16/2026]**  
Insert accompanying block 38° 01'.62 S 144° 34'.78 E

**52(T)/2026 AUSTRALIA - QUEENSLAND - Breaksea Spit - Light buoy unlit**  
Australian Maritime Safety Authority Auscoast Warning 351/2025

The north cardinal light buoy, Q AIS Racon (G) (24° 21'.14 S 153° 09'.11 E), is unlit.

Mariners are advised to navigate with caution in the area.

**Chart temporarily affected - Aus 490 - Aus 816 - Aus 818**

**53(T)/2026 AUSTRALIA - QUEENSLAND - Bribie Island - Bellara - Harbour works complete**  
Former Notice - 604(T)/2025 is cancelled  
Maritime Safety Queensland Notice 297(T)/2025

Cancel this notice on receipt.

**Chart formerly affected - Aus 236**

**54(T)/2026 AUSTRALIA - QUEENSLAND - Brisbane River - Lytton Rocks Reach - Light relit**  
Former Notice - 252(T)/2025 is cancelled  
Maritime Safety Queensland Notice 569(T)/2025

Cancel this notice on receipt.

**Chart formerly affected - Aus 236 - Aus 237**

**55(T)/2026 AUSTRALIA - QUEENSLAND - Bundaberg - Burnett Heads - Fish aggregating device restored**  
Former Notice - 136(T)/2025 is cancelled  
Department of Primary Industries

Cancel this notice on receipt.

**Chart formerly affected - Aus 817 - Aus 818**

**56(T)/2026 AUSTRALIA - QUEENSLAND - Caloundra Head - Scientific instruments**  
Maritime Safety Queensland Notice 026(T)/2026

Water quality monitoring special light buoys, Fl.Y.3s, exist in the following positions:  
26° 50'.44 S 153° 07'.97 E  
26° 48'.93 S 153° 08'.36 E

**Chart temporarily affected - Aus 236 - Aus 815**

**57(T)/2026 AUSTRALIA - QUEENSLAND - Cleveland Bay - Scientific instruments**  
Former Notice - 596(T)/2024 is cancelled  
Maritime Safety Queensland Notice 023(T)/2026

Special light buoys, Fl.Y.2.5s, exist in the following positions:  
19° 06'.45 S 146° 32'.48 E  
19° 07'.34 S 146° 52'.92 E  
19° 09'.32 S 146° 52'.10 E  
19° 12'.79 S 146° 47'.55 E  
19° 13'.58 S 146° 56'.98 E  
19° 14'.80 S 146° 48'.90 E.

Mariners are advised to navigate with caution in the area.

**Chart temporarily affected - Aus 256 - Aus 827**

**58(T)/2026 AUSTRALIA - QUEENSLAND - Gladstone - South Channel - Light beacon damaged and unlit**  
Maritime Safety Queensland Notice 31(T)/2026

The port lateral light beacon, *Fl.R.4s S28* (23° 54'.17 S 151° 23'.56 E), is damaged and may appear unlit.

Mariners are advised to navigate with caution in the area.

**Chart temporarily affected - Aus 246**

**59(T)/2026 AUSTRALIA - QUEENSLAND - Great Sandy Strait - Scientific instruments**  
*Former Notice - 18(T)/2026 is cancelled*  
Maritime Safety Queensland Notice 017(T)/2026

Special light buoys exists as follows:

<i>Position</i>	<i>Remarks</i>
25° 16'.19 S 152° 51'.05 E	<i>Fl.Y.2·5s</i>
25° 16'.82 S 152° 51'.23 E	<i>Fl.Y.2·5s</i>
25° 07'.27 S 152° 47'.99 E	<i>Fl(5)Y.20s.</i>

Mariners are advised to navigate with caution in the area.

**Chart temporarily affected - Aus 817**

**60(T)/2026 AUSTRALIA - QUEENSLAND - Moreton Bay - Scientific instruments recovered**  
*Former Notice - 909(T)/2025 is cancelled*  
Maritime Safety Queensland Notice 471(T)/2025

Cancel this notice on receipt.

**Chart formerly affected - Aus 236 - Aus 237**

**61(T)/2026 AUSTRALIA - QUEENSLAND - Port Alma - Cairns - Navaids destroyed or off station; depths**  
Maritime Safety Queensland Notice 18(T)/2026

Recent flooding has occurred in many areas of Central Queensland between Hay Point and Cairns.

Obstructions may exist and depths may not be consistent with charted information. Navaids may be off station or destroyed.

Mariners are advised to navigate with extreme caution in the area.

**Chart temporarily affected - Aus 248 - Aus 249 - Aus 250 - Aus 251 - Aus 252 - Aus 253 - Aus 254 - Aus 256 - Aus 259 - Aus 260 - Aus 265 - Aus 367 - Aus 490 - Aus 819 - Aus 820 - Aus 821 - Aus 822 - Aus 823 - Aus 824 - Aus 825 - Aus 826 - Aus 827 - Aus 828 - Aus 829 - Aus 830**

**62(T)/2026 AUSTRALIA - NORTHERN TERRITORY - Beagle Gulf - Fenton Patches - Fish aggregating devices**  
*Former Notice - 19(T)/2026 is cancelled*  
Northern Territory Government Notice 001(T)/2026

Special light buoys, *Fl.Y.4s FAD*, exist in the following positions:

12° 06'.66 S 130° 34'.13 E
12° 08'.93 S 130° 44'.83 E
12° 09'.50 S 130° 44'.83 E
12° 10'.30 S 130° 38'.50 E.

**Chart temporarily affected - Aus 309**

**63(T)/2026 AUSTRALIA - WESTERN AUSTRALIA - NEW SOUTH WALES - Perth to Sydney - Cable laying operations**  
Gulf Agency Company (Australia)

Cable laying operations will be conducted between Perth and Sydney. Cable lay and post lay inspection activities will occur along the route shown in the diagram and mariners are advised to keep clear of vessels, *He d'ye* and *Peter Faber*, during activities. Further advice on specific areas of activity will be issued through the AUSCOAST warning system.

Note: For e-notice users, please see full edition for map.

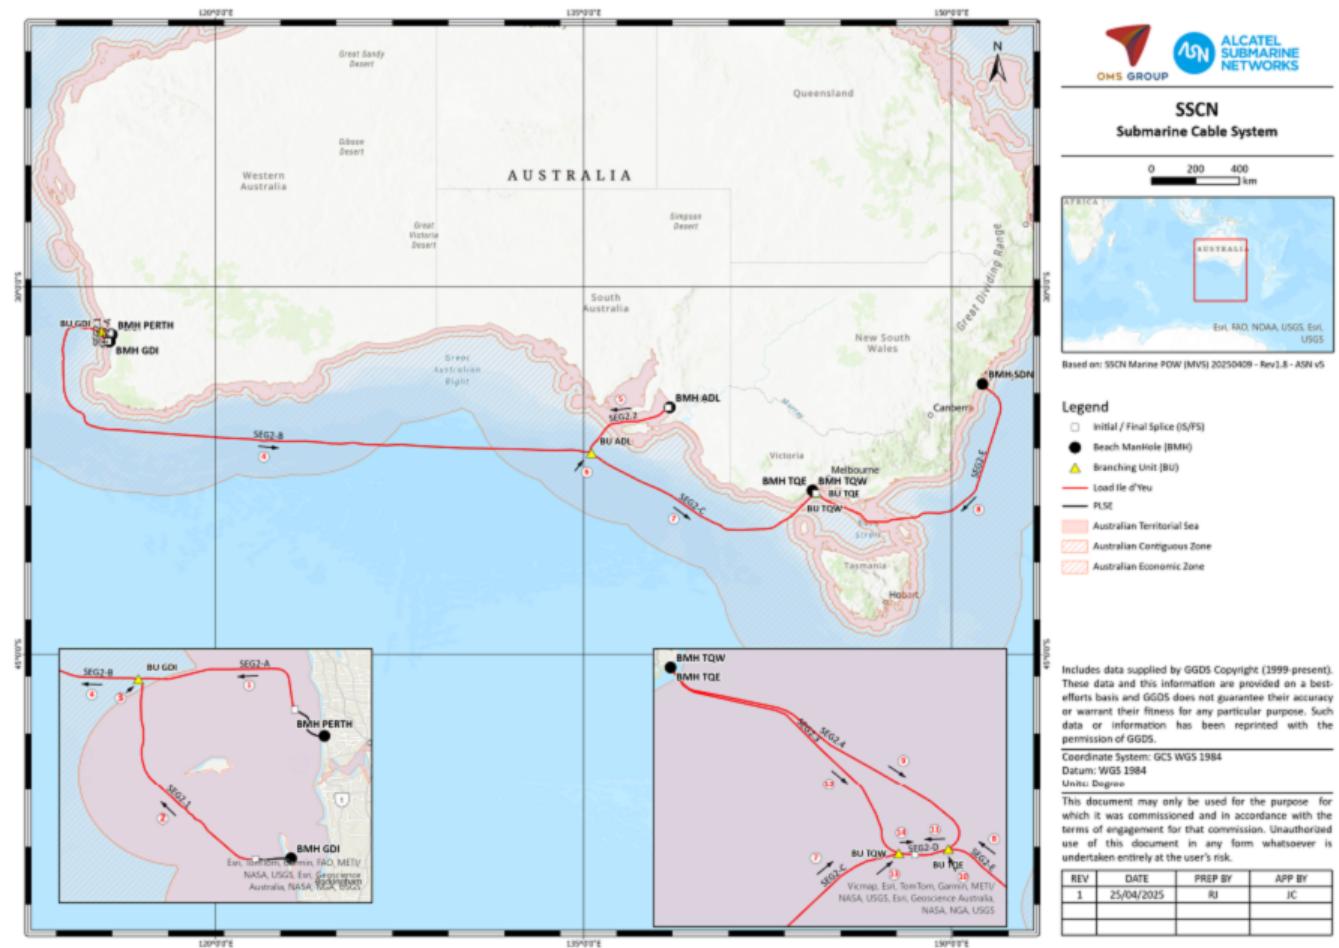


Chart temporarily affected - Aus 130 - Aus 143 - Aus 198 - Aus 335 - Aus 336 - Aus 343 - Aus 346 - Aus 348 - Aus 349 - Aus 357 - Aus 485 - Aus 487 - Aus 489 - Aus 754 - Aus 780 - Aus 781 - Aus 801 - Aus 802 - Aus 808 - Aus 4601 (INT 601) - Aus 4602 (INT 602) - Aus 4708 (INT 708) - Aus 4709 (INT 709) - Aus 4710 (INT 710)

**64(T)/2026 AUSTRALIA - WESTERN AUSTRALIA - NEW SOUTH WALES - Perth to Sydney - Cable laying operations**  
*Former Notice - 497(T)/2025 is cancelled*  
Gulf Agency Company (Australia)

Cancel this notice on receipt.

**Chart formerly affected - Aus 130 - Aus 143 - Aus 198 - Aus 335 - Aus 336 - Aus 343 - Aus 346 - Aus 348 - Aus 349 - Aus 357 - Aus 485 - Aus 487 - Aus 489 - Aus 754 - Aus 780 - Aus 781 - Aus 801 - Aus 802 - Aus 808 - Aus 4601 (INT 601) - Aus 4602 (INT 602) - Aus 4708 (INT 708) - Aus 4709 (INT 709) - Aus 4710 (INT 710)**

**65(T)/2026 AUSTRALIA - WESTERN AUSTRALIA - Onslow - Beadon Creek - Pipe laying operations completed**  
*Former Notice - 419(T)/2025 is cancelled*

Department of Transport WA Notice 6454/2025

Cancel this notice on receipt.

### Chart formerly affected - Aus 64

**66(T)/2026 AUSTRALIA - SOUTH AUSTRALIA - Great Australian Bight - Satellite re-entry**

*Former Notice - 30(T)/2026 is cancelled*

Southern Launch

Southern Launch will be conducting re-entry activities during the period 1100-1500 HRS, 24 January - 1 February 2026.

Satellite components may impact the waters within an area bounded by the following positions:

32° 02' 62 S 132° 55'.48 E

32° 02'.79 S 133° 23'.84 E

32° 53'.65 S 133° 33'.74 E

32° 57'.09 S 133° 10'.63 E

32° 02'.62 S 132° 55'.48 E.

Mariners are advised to be aware of floating debris hazards and to navigate with caution.

**Chart temporarily affected - Aus 120 - Aus 341**

**67(T)/2026 AUSTRALIA - SOUTH AUSTRALIA - Kangaroo Island - Survey operations completed**

*Former Notice - 148(T)/2025 is cancelled*

Guardian Geomatics

Cancel this notice on receipt.

**Chart formerly affected - Aus 346 - Aus 485**

**68(T)/2026 AUSTRALIA - SOUTH AUSTRALIA - Kangaroo Island - Survey operations; tide gauges, southwards**

Fugro

Hydrographic survey operations are underway. Tide gauges rising approximately 3 meters from the seabed, exist in the following positions:

36° 04'.9 S 137° 26'.4 E

36° 03'.6 S 136° 59'.9 E

35° 59'.6 S 137° 13'.3 E

36° 13'.6 S 137° 10'.8 E

36° 12'.5 S 136° 58'.5 E

36° 17'.9 S 137° 23'.3 E

36° 30'.0 S 137° 19'.2 E

36° 22'.5 S 137° 03'.6 E

36° 13'.5 S 136° 46'.6 E

36° 04'.9 S 136° 29'.4 E

35° 55'.2 S 136° 29'.4 E

35° 59'.3 S 136° 39'.2 E

36° 04'.3 S 136° 43'.2 E

A special flashing light buoy may be deployed for short periods in the vicinity of the above positions.

A target obstruction rising 1m from the seabed exists in position 35° 44'.5 S 136° 38'.1 E

Mariners are advised to navigate with caution in the area.

**Chart temporarily affected - Aus 343 - Aus 346 - Aus 780**

**69(T)/2026 AUSTRALIA - SOUTH AUSTRALIA - Two Hummock Point to Point Riley - Scientific instruments recovered**

*Former Notice - 998(T)/2022 is cancelled*

Department for Infrastructure and Transport SA Notice 41(T)/2022

Cancel this notice on receipt.

**Chart formerly affected - Aus 777 - Aus 778**

**70(T)/2026 AUSTRALIA - VICTORIA - Lakes Entrance - Survey operations eastwards**  
Safe Transport Victoria NTM 27(T)/2026

On or about 27 January 2026, an unmanned surface vehicle (USV), *Fugro Kwilena*, will be conducting infrastructure survey operations in an area bounded by the following positions:

37° 51'.19 S 148° 25'.91 E  
37° 48'.57 S 148° 25'.83 E  
37° 48'.57 S 148° 26'.64 E  
37° 51'.17 S 148° 26'.66 E.

Mariners are advised to navigate with caution in the area.

**Chart temporarily affected - Aus 357**

**71(T)/2026 AUSTRALIA - VICTORIA - Port Campbell - Drill rig southwestwards**

*Former Notice - 1086(T)/2025 is cancelled*

*MODU Transocean Equinox*

Cancel this notice on receipt.

**Chart formerly affected - Aus 349**

**72(T)/2026 AUSTRALIA - VICTORIA - Port Phillip - Coles Channel - Light beacon relit**

*Former Notice - 1089(T)/2025 is cancelled*

*Parks Victoria Notice 634(T)/2025*

Cancel this notice on receipt.

**Chart formerly affected - Aus 143 - Aus 157**

**73(T)/2026 AUSTRALIA - VICTORIA - Port Phillip - Point Nepean - Light beacon relit**

*Former Notice - 1088(T)/2025 is cancelled*

*Parks Victoria Notice 635(T)/2025*

Cancel this notice on receipt.

**Chart formerly affected - Aus 144**

**74(T)/2026 AUSTRALIA - VICTORIA - Port Phillip - Mordialloc - Light restored**

*Former Notice - 961(T)/2025 is cancelled*

*Parks Victoria Notice 660(T)/2025*

Cancel this notice on receipt.

**Chart formerly affected - Aus 143 - Aus 155**

**75(T)/2026 AUSTRALIA - VICTORIA - Port Phillip - Light buoy restored**

*Former Notice - 890(T)/2025 is cancelled*

*Parks Victoria Notice 659(T)/2025*

Cancel this notice on receipt.

**Chart formerly affected - Aus 155**

**76(T)/2026 AUSTRALIA - VICTORIA - Port Phillip - Sandringham - Light buoy restored**

*Former Notice - 80(T)/2024 is cancelled*

*Parks Victoria Notice 655(T)/2025*

Cancel this notice on receipt.

**Chart formerly affected - Aus 155**

**77(T)/2026 AUSTRALIA - VICTORIA - Port Phillip - Altona - Light buoy damaged and unlit**  
Parks Victoria Notice 661(T)/2025

The south cardinal light buoy, VQ(6)+LFI.10s ( $37^{\circ} 52'.41\text{ S }144^{\circ} 50'.70\text{ E}$ ), is unlit and the topmark is missing.

Mariners are advised to navigate with caution in the area.

**Chart temporarily affected - Aus 155**

**78(T)/2026 AUSTRALIA - VICTORIA - Port Phillip - Swan Bay - Light unlit**  
Parks Victoria Notice 7(T)/2026

The light, *Fl.5s 5m 2M* ( $38^{\circ} 13'.68\text{ S }144^{\circ} 39'.32\text{ E}$ ), is unlit.

**Chart temporarily affected - Aus 143**

**79(T)/2026 AUSTRALIA - VICTORIA - Western Port - Gentle Annie Channel - Beacon destroyed**  
Parks Victoria Notice 006(T)/2026

The port lateral beacon, *No4* ( $38^{\circ} 14'.96\text{ S }145^{\circ} 19'.93\text{ E}$ ), has been destroyed.

Mariners are advised to navigate with caution in the area.

**Chart temporarily affected - Aus 151**

**80(T)/2026 AUSTRALIA - TASMANIA - River Derwent - Storm Bay - Frederick Henry Bay - Sea trials**  
MAST M015/2026

INCAT vessel *China Zorrilla* will be conducting sea trials in the Storm Bay, Frederick Henry Bay and River Derwent areas. A 300 meter clearance is requested at all times, due to speed and possible sudden deviations of course, along with high volumes of water movement from the vessels jet propulsion.

Mariners are advised to navigate with caution in the vicinity of the craft.

**Chart temporarily affected - Aus 171 - Aus 173 - Aus 795 - Aus 796**

**81(T)/2026 AUSTRALIA - TASMANIA - Yellow Point - Wreck**  
Marine and Safety Tasmania Notice M394(T)/2025

A wreck marked by a blue and yellow buoy exists in position  $43^{\circ} 10'.92\text{ S }147^{\circ} 14'.99\text{ E}$ .

Mariners are advised to navigate with caution in the area.

**Chart temporarily affected - Aus 173 - Aus 795**

**82(T)/2026 SOLOMON ISLANDS - New Georgia Group - South Island - Light relit**  
Former Notice - 276(T)/2025 is cancelled  
Solomon Islands Maritime Authority NTM 23/2025

Cancel this notice on receipt.

**Chart formerly affected - Aus 4060 (INT 60) - Aus 4604 (INT 604) - SLB 302 - SLB 1001 - SLB 1002**

**83(T)/2026 SOLOMON ISLANDS - Nusatupe Island - Light beacon relit; topmark destroyed**  
Former Notice - 805(T)/2025 is cancelled  
Solomon Islands Maritime Authority Notice 20/2025

The topmark on light beacon, *Fl(3)R.10s 11m 5M* ( $8^{\circ} 05'.55\text{ S }156^{\circ} 51'.82\text{ E}$ ), has been destroyed.

**Chart temporarily affected - SLB 102 - SLB 301 - SLB 302**

II

**HYDROGRAPHIC REPORTS**

**NIL**